

### CCR Landfill 2021 Annual Inspection Report NC2 Ash Disposal Area



Omaha Public Power District Nebraska City Station

Nebraska City, Nebraska January 14, 2022

# OPPD Nebraska City Station NC2 Ash Disposal Area CCR Landfill 2021 Annual Inspection Report

#### **Table of Contents**

Professional Engineer Certification				
1	Introduction		2	
	1.1	L	Purpose	. 2
	1.2	2	Facility Background	. 2
2 Review of Available Information (40 CFR 257.84(B)(1)(i))		Revi	ew of Available Information (40 CFR 257.84(B)(1)(i))	. 3
3	,	Visual Site Inspection (40 CFR 257.84(B)(1)(ii))		. 3
	3.1	L	Extent of Inspection	. 3
	3.2	2	Inspection Findings	4
4		Char	nges in Geometry	4
5	Approximate CCR Volume		. 4	
6		Appearance of Structural Weakness		
7		Changes Affecting Stability or Operation		4

#### **Appendices**

Appendix A: Facility Site Map

## OPPD Nebraska City Station NC2 Ash Disposal Area CCR Landfill 2021 Annual Inspection Report

#### **Professional Engineer Certification**

"I hereby certify that the CCR landfill known as the NC2 Ash Disposal Area at the Nebraska City Generating Station, owned and operated by the Omaha Public Power District, was inspected and this report prepared in accordance with the Coal Combustion Residual Rule 40 CFR 257.84(b). Iam a duly licensed Professional Engineer under the laws of the State of Nebraska."

Name: Joseph R. Shields. PE

Registration State: Nebraska

Registration Number: E-8034

Date: 1/14/2022

My license renewal date is December 31, 2022.

#### 1 Introduction

Omaha Public Power District (OPPD), Nebraska City Generating Station (Station) currently operates an active coal combustion residual (CCR) landfill, referred to as the NC2 Ash Disposal Area. On April 17, 2015, the U.S. Environmental Protection Agency (EPA) published the final rule for the regulation and management of CCR under Subtitle D of the Resource Conservation and Recovery Act (CCR Rule). Requirements for the disposal and handling of CCR within units (either landfills or surface impoundments) are defined in 40 Code of Federal Regulations (CFR) Section 257.

Section 257.84(b) of the regulations specifies that an owner or operator of a CCR landfill must have a qualified professional engineer inspect the landfill annually to ensure that the design, construction, operation, and maintenance of the CCR unit is consistent with recognized and generally accepted good engineering standards. This annual inspection report meets this requirement for the NC2 Ash Disposal Area.

#### 1.1 Purpose

The CCR rule requires the initial inspection report for existing CCR landfills must be completed and filed in the operating record on an annual basis. The completion date of the last inspection report (i.e., placed in the facility operating record) establishes the deadline to complete the next inspection. Subsequent inspections and reports must be completed and filed on an annual basis. The requirements of the annual inspection include:

- A review of available information regarding the status and condition of the CCR unit
   257.84 (B)(1)(i),
- A visual inspection of the CCR unit to identify signs of distress or malfunction -257.84 (B)(1)(ii),
- An inspection report that includes the following:
  - Changes in geometry since the last inspection 257.84 (B)(2)(i)
  - Approximate volume of CCR in unit at time of inspection 257.84 (B)(2)(ii)
  - Appearance of actual or potential structural weakness of the CCR unit, in addition to any existing conditions that are disrupting or have the potential to disrupt the operation and safety of the CCR unit - 257.84 (B)(2)(iii)
  - Any other changes which may have affected the stability or operation of the CCR unit since the last inspection - 257.84 (B)(2)(iv)

OPPD, as owner and operator of the Station, must notify the Nebraska Department of Environment and Energy (NDEE) Director within 30 days of placing the CCR Landfill Annual Inspection Report in the operating record and posting to the CCR web site (40 CFR §257.106 and §257.107).

#### 1.2 Facility Background

The Station located 5.5 miles southeast of Nebraska City, Nebraska, along the west shore of the Missouri River. NC2 Ash Disposal Area CCR landfill is permitted under the current NDEE

Title 132 regulations for fossil fuel combustion ash disposal area (NDEE Permit No. NE0204421, Facility ID 58343). The NC2 Ash Disposal Area is a CCR landfill with a composite liner and leachate collection system and encompasses a total of 40.7 acres. A facility site map is included in Appendix A.

#### 2 Review of Available Information (40 CFR 257.84(B)(1)(i))

Numerous documents pertaining to the operation and structural integrity of the CCR landfill were reviewed before, during and after the site inspection, including:

- The CCR Landfill weekly inspection records (per Section 257.84(a))
- NDEE Title 132 permit
- Documentation regarding recent NC2 Ash Disposal Area, Cell 1 Closure

Review of the above documents did not uncover any unresolved issues that indicated operational, safety or structural concerns of the CCR landfill. Currently, Cell 1 of the NC2 Ash Disposal Area has been graded and received final cover. During the inspection, landfilling operations were occurring at Cells 2 and 3.

#### **3 Visual Site Inspection (40 CFR 257.84(B)(1)(ii))**

On November 29, 2021, OPPD personnel performed a site inspection of the NC2 Ash Disposal Area, including:

- Joseph R. Shields PE, Senior Engineer
- Mark Hansen, Environmental Affairs Program Administrator
- Kyle Uhing, Senior Environmental Specialist
- Aaron O'Donnell, Chemist

The weather during the site visit was partly cloudy with temperatures approximately 60 degrees Fahrenheit. The site was free of snow cover.

#### 3.1 Extent of Inspection

The inspection included a driving and walking review of the NC2 Ash Disposal Area. As the CCR rule only requires the inspection of the existing active CCR landfill itself, this report does not address the condition of the groundwater monitoring system, access roads beyond the landfill perimeter, grades and drainage channels that are not a component of the CCR landfill.

The field visit included inspection of the following:

- Perimeter channel conditions
- Side slope conditions
- Top of closed landfill cell
- General drainage

Leachate pond(s)

#### 3.2 Inspection Findings

The following are the findings of the site inspection:

- Minor rill erosion was noted in the drainage channel on the north side of Cell 1 during last year's inspection and was inspected. The erosion is located west of the stilling basin northeast of the landfill and was not near landfilled ash or a stability concern.
   OPPD will continue to monitor the erosion during future inspections.
- Minor erosion was noted on the temporary access road to the top of Cell 1 during the 2020 inspection. To remedy the erosion, straw waddles were installed. During the 2021 inspection, it appeared that the waddles were effective in mitigating erosion. Some of the waddles had recently been moved and will be re-installed.
- Drainage paths were clear and appeared to be functional.
- Slopes and let down structures were in good condition and no deficiencies were noted.
- CCR was being placed, spread, and compacted in Cell 2/3 footprint.

#### 4 Changes in Geometry

The CCR rule requires that the site geometry changes be identified since the last annual inspection. The continuing CCR placement in Cell 2/3 is the only change in geometry.

#### 5 Approximate CCR Volume

Total ash disposal was estimated based on the August 2021 survey which estimated that the total remaining airspace in the landfill was 2,173,000 cubic yards, which indicates that about 1,485,000 cubic yards of ash was in place. The estimated quantity of CCR deposited in 2021 through November is approximately 192,000 cubic yards. It is estimated that the total volume of CCR landfilled at the time of inspection was about 1,537,000 cubic yards.


#### 6 Appearance of Structural Weakness

Based on the visual inspection, no apparent or potential structural weaknesses were observed.

#### 7 Changes Affecting Stability or Operation

The CCR rule requires identification of changes that affect stability or operation of the CCR landfill since the last annual inspection. No changes that affect stability or operation were identified.

### Appendix A Facility Site Map

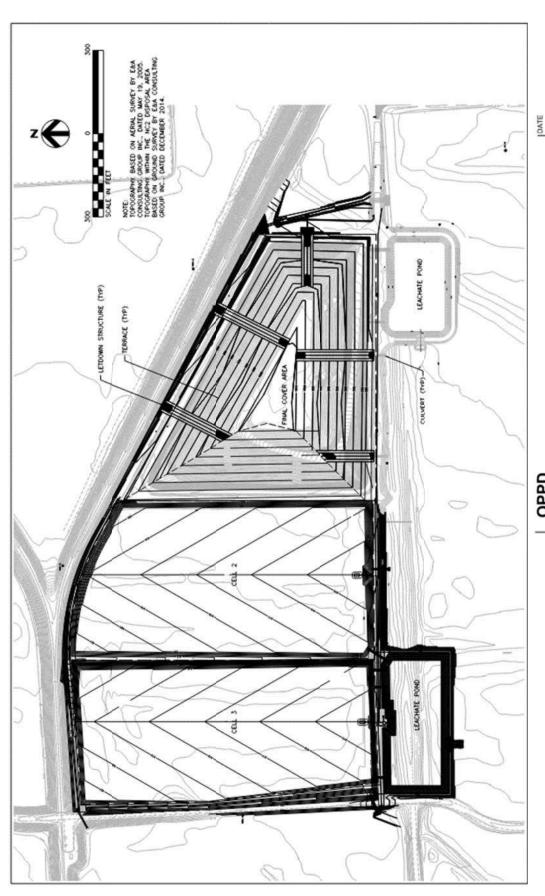

OPPD NEBRASKA CITY STATION NC2 ASH DISPOSAL AREA

INSPECTION MAP

DECEMBER 2021 FIGURE